Instruction includes methods of montage:
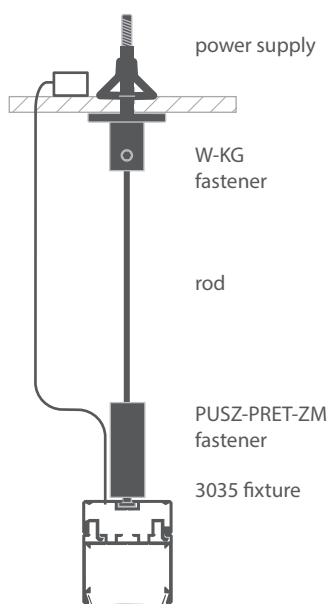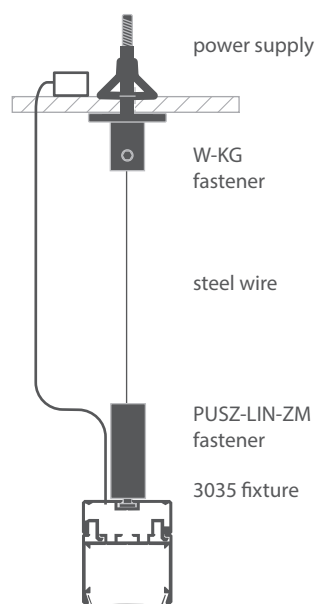
1) Rod - non-conductive (drop lead)
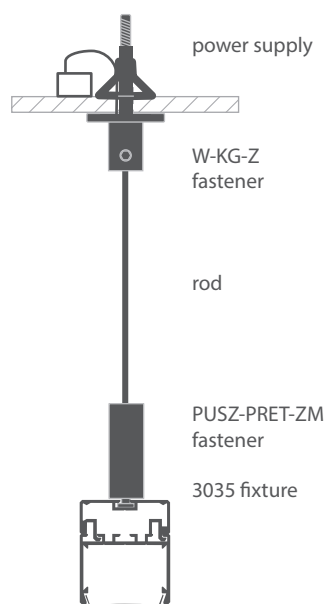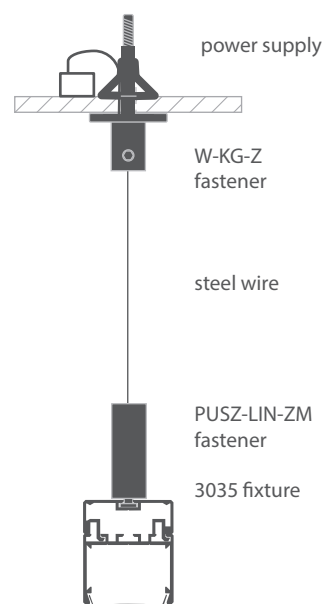
power supply

W-KG fastener

rod

PUSZ-PRET-ZM fastener

3035 fixture

2) Rod - conductive driven power supply

power supply

W-KG-Z fastener

rod

PUSZ-PRET-ZM fastener

3035 fixture

3) Wire - non-conductive (drop lead)

power supply

W-KG fastener

steel wire

PUSZ-LIN-ZM fastener

3035 fixture

4) Wire - Rod - conductive driven power supply

power supply

W-KG-Z fastener

steel wire

PUSZ-LIN-ZM fastener

3035 fixture

Tools needed for mounting:

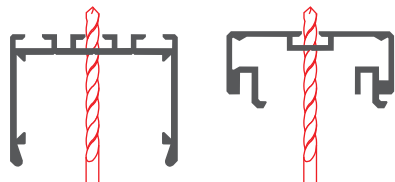- drill
- pliers
- allen wrench
- soldering iron

NOTE! All LED strips must be connected to a 12 V or 24 V power supply.

IMPORTANT: The manual presents the simplest mounting procedure.
More mounting procedures and related accessories can be found at klusdesign.eu

KLUŚ® | **Inspiring Solutions**

3035 - suspended fixture mounting instructions
2. Rod - conductive driven power supply
*If fully built fixtures are ordered and received from KLUS please skip to #3

1. Drill 2 holes in the mounting track to install the fasteners and 1 hole in the extrusion to lead the powering cables.
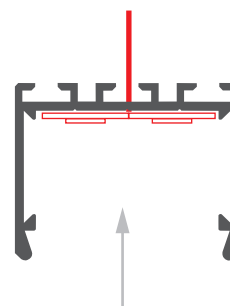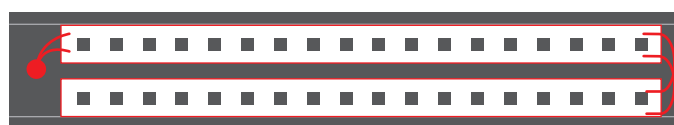
cross-section

top view

2. Mount the LED strip in the extrusion and lead the cable through a pre-drilled hole.
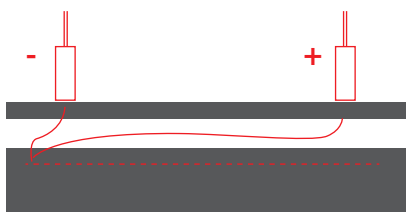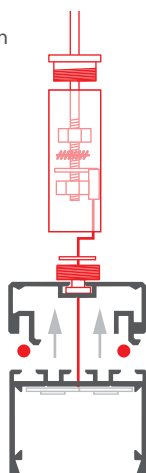
cross-section

bottom view

3. Install the PUSZ-PRET-ZM fasteners with rods on the mounting track and join the extrusion and mounting track with the use of BLOK springs. One pole of power should be connected to a single fastener. Both fastener and 3035 extrusion installation manuals can be downloaded at www.klusdesign.eu.
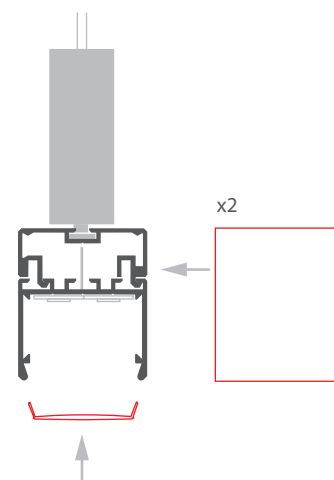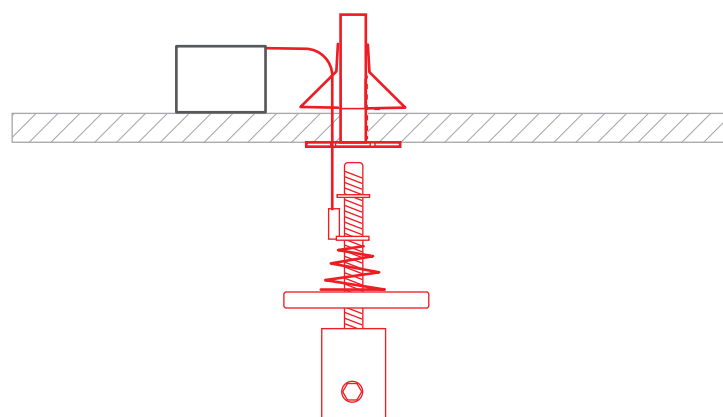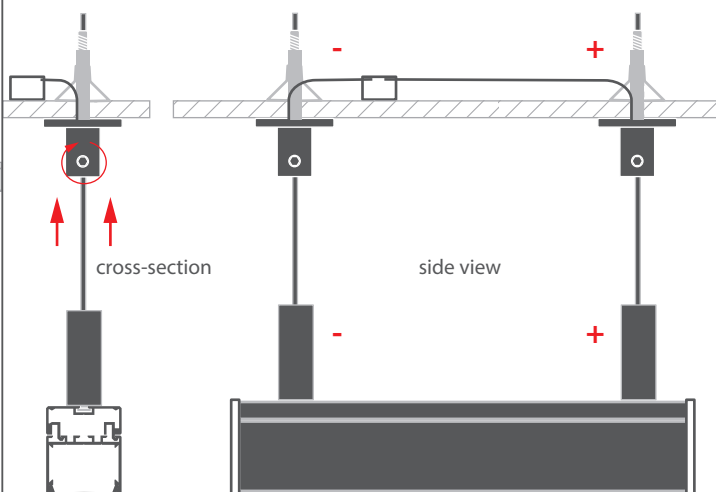
side view

cross-section

- +

4. Install the cover and both end caps.

x2

5. Install the W-KG-Z ceiling fasteners. The fastener installation manual can be downloaded at www.klusdesign.eu. Connect the cables, each for the single power pole to the fasteners. The cables should go through a pre-drilled hole just under the masking cover of the fastener.
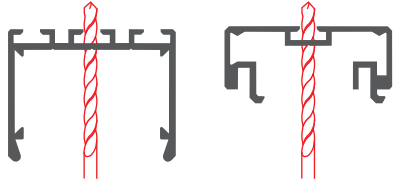
6. Mount the fixture with rods into the ceiling fasteners. Connect the cable to the power supplier, leading it through a pre-drilled hole in the ceiling.

- +

cross-section   side view

- +

KLUŚ® **Inspiring Solutions**

3035 - suspended fixture mounting instructions
1. Rod - non-conductive (requires drop lead)
*If fully built fixtures are ordered and received from KLUS please skip to #3

1. Drill the holes in both extrusion and the mounting track to lead the powering cables.
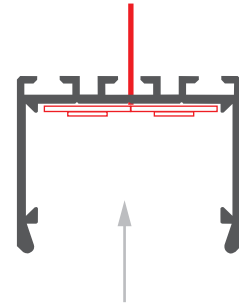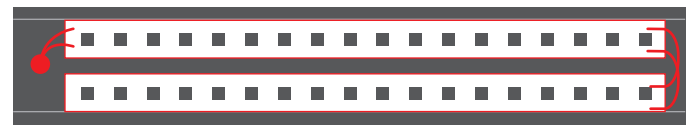
cross-section

top view

2. Mount the LED strip in the extrusion and lead the cable through a pre-drilled hole.
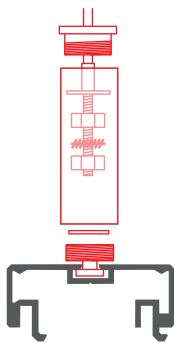
cross-section

bottom view

3. Install the PUSZ-PRET-ZM fasteners with rods on the mounting track. The fastener installation manual can be downloaded at www.klusdesign.eu.
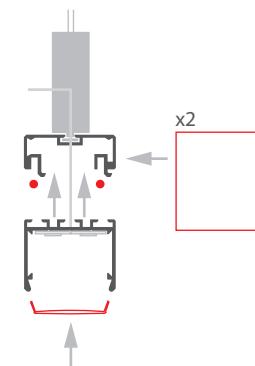
cross-section

top view

4. Join the extrusion with the mounting track with the use of BLOK springs. Installation manual for 3035 extrusion can be downloaded from www.klusdesign.eu. Install the cover and both end caps.
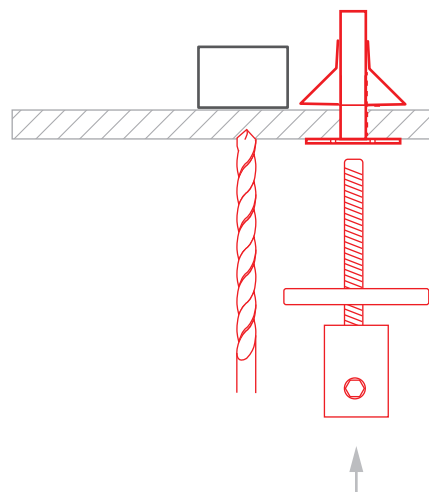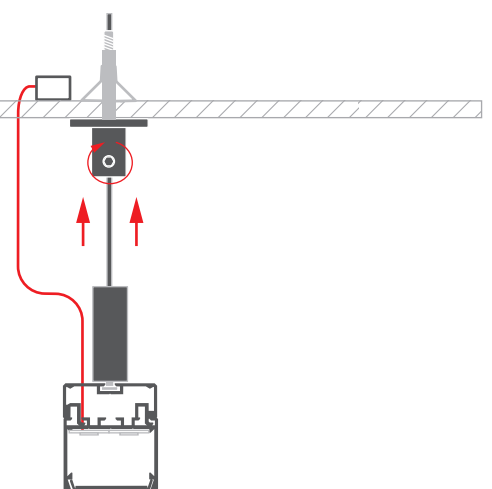
cross-section

x2

top view

5. Install the W-KG ceiling fasteners. The fastener installation manual can be downloaded at www.klusdesign.eu. Place the power supplier next to the fastener and drill the ceiling to lead the cable to it.
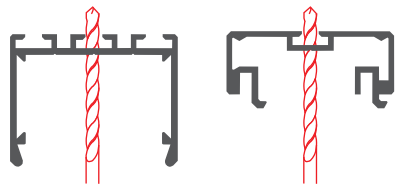

6. Mount the fixture with rods into the ceiling fasteners. Connect the cable to the power supplier, leading it through a pre-drilled hole in the ceiling.

KLUŚ | **Inspiring Solutions**

3035 - suspended fixture mounting instructions
3. Wire - non-conductive (requires drop lead)
*If fully built fixtures are ordered and received from KLUS please skip to #3

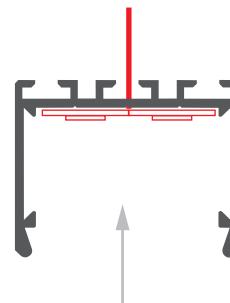**1.** Drill the holes in both extrusions and the mounting track to lead the powering cables.
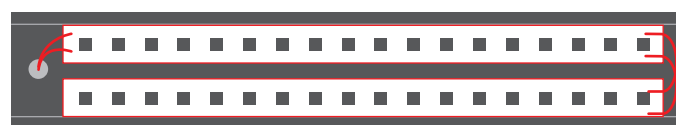
cross-section

top view

2. Mount the LED strip in the extrusion and lead the cable through a pre-drilled hole.
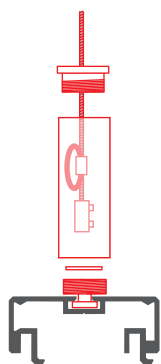
cross-section

bottom view

3. Install the PUSZ-LIN-ZM fasteners with rods on the mounting track. The fastener installation manual can be downloaded at www.klusdesign.eu.
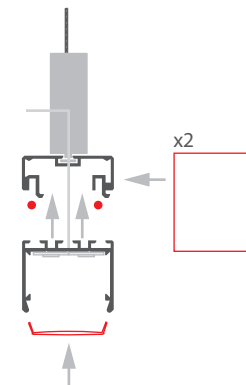
cross-section

top view

4. Join the extrusion with the mounting track with the use of BLOK springs. Installation manual for 3035 extrusion can be downloaded from www.klusdesign.eu. Install the cover and both end caps.
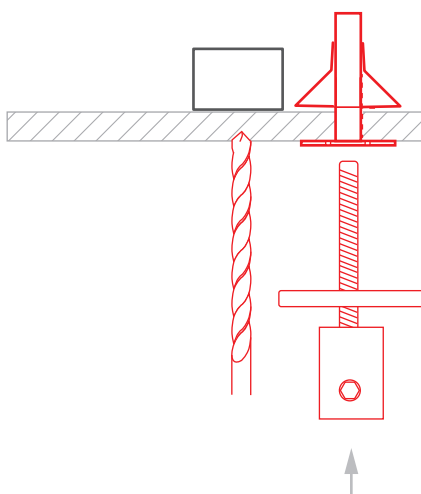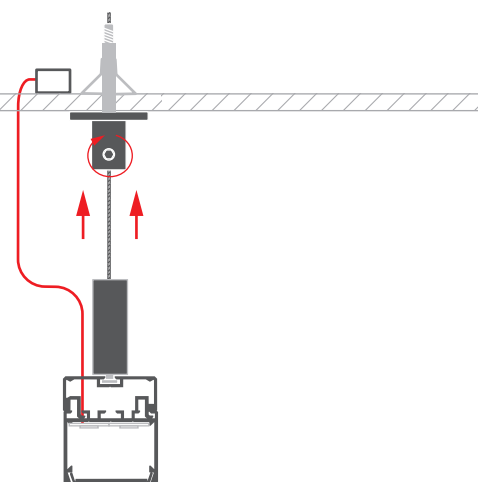
cross-section

x2

top view

5. Install the W-KG ceiling fasteners. The fastener installation manual can be downloaded at www.klusdesign.eu. Place the power supplier next to the fastener and drill the ceiling to lead the cable to it.
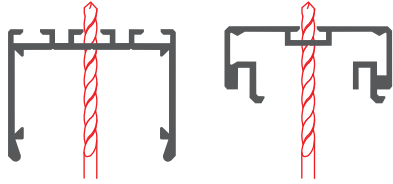

6. Mount the fixture with rods into the ceiling fasteners. Connect the cable to the power supplier, leading it through a pre-drilled hole in the ceiling.

KLUŚ® Inspiring Solutions

3035 - suspended fixture mounting instructions
4. Wire - conductive driven power supply
*If fully built fixtures are ordered and received from KLUS please skip to #3

1. Drill the holes in both extrusions and the mounting track to lead the powering cables.
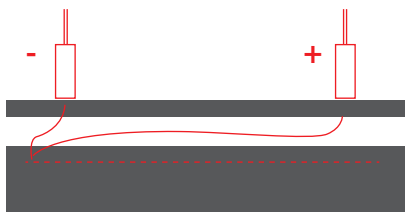
cross-section

top view

2. Mount the LED strip in the extrusion and lead the cable through a pre-drilled hole.

cross-section

bottom view   Positive pole has to be soldered

Negative pole has to be soldered

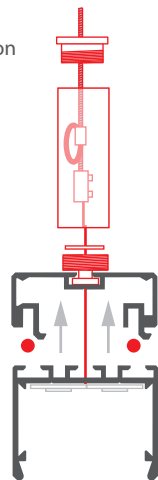**3.** Install the PUSZ-LIN-ZM fasteners with rods on the mounting track and join the extrusion and mounting track with the use of BLOK springs. One pole of power should be connected to a single fastener Both fastener and 3035 extrusion installation manuals can be downloaded at www.klusdesign.eu.
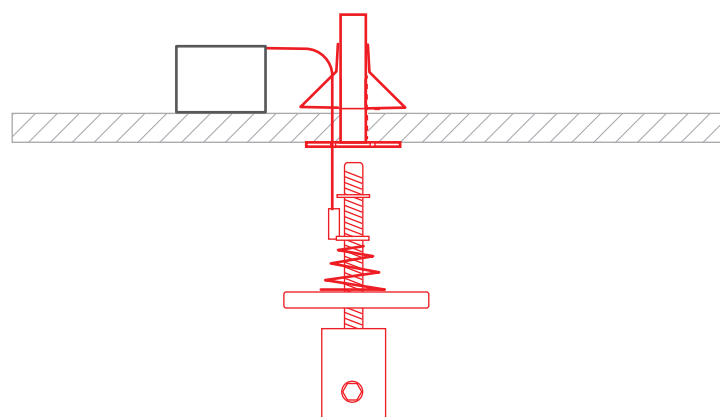
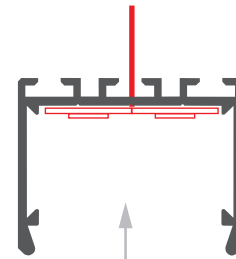side view   cross-section

4. Install the cover and both end caps.

x2

5. Install the W-KG-Z ceiling fasteners. The fastener installation manual can be downloaded at www.klusdesign.eu. Connect the cables, each for the single power pole to the fasteners. The cables should go through a pre-drilled hole just under the masking cover of the fastener.

6. Mount the fixture with rods into the ceiling fasteners. Connect the cable to the power supplier, leading it through a pre-drilled hole in the ceiling.

cross-section   side view